


ASSEMBLY & INSTALLATION INSTRUCTIONS

A567

Stella Chandelier 105057

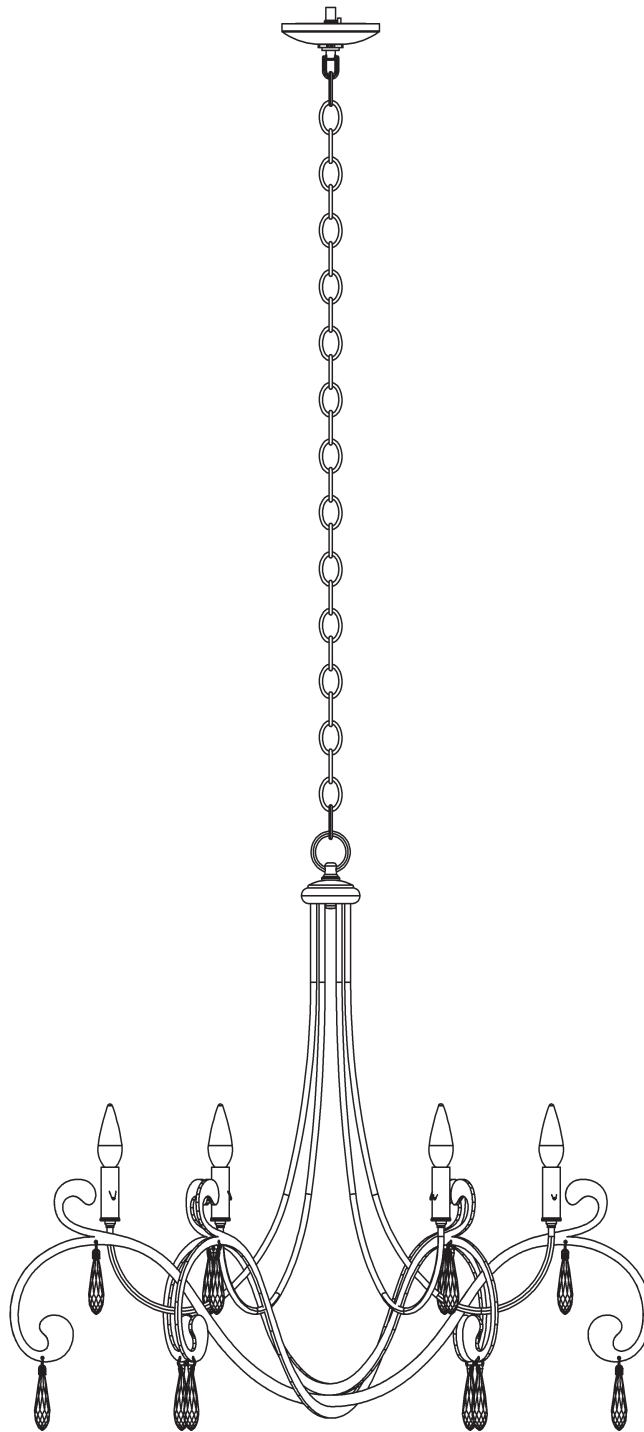

HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

42722 Rev A

Component Parts

- A Crossbar**
- B Lock Nut**
- C Nipple**
- D Ground Screw**
- E Canopy**
- F Canopy Ring**
- G Canopy Loop**
- H Chain**
- I Fixture Loop**
- J Fixture**
- K Socket (6)**
- L Crystal (12)**
- M Pinch Bail (6)**
- N Jump Ring (6)**



ASSEMBLY & INSTALLATION INSTRUCTIONS

A567

Stella Chandelier 105057

CAUTION: FAILURE TO INSTALL THIS FIXTURE PROPERLY MAY RESULT IN SERIOUS PERSONAL INJURY OR DEATH AND PROPERTY DAMAGE. We recommend installation by a licensed electrician. This product must be installed in accordance with applicable installation code(s), by a person familiar with the construction and operation of the product and the hazards involved.*

Caution: Do not exceed maximum wattage noted on fixture. Use only recommended bulbs with fixture.

Please Note: After installation extra hardware and accessories are possible due to our kits are used on multiple products and options.

To Attach to Ceiling (Figure 1)

CAUTION: BE SURE POWER IS OFF AT THE MAIN BREAKER BOX PRIOR TO INSTALLATION.

1. Carefully unpack fixture from the carton.
2. Using two machine screws (not provided), fasten the crossbar (A) to the electric box with the head of the ground screw (D) facing down.

Note: A new electric box comes with screws. When replacing a fixture, retain the existing screws for use with the new fixture.

3. Thread nipple (C) into crossbar (A) and then thread lock nut (B) and canopy loop (G) onto threaded nipple leaving parts loose. Adjust the length of threaded nipple in crossbar so canopy ring (F), which comes threaded onto canopy loop, will hold canopy (E) against the ceiling with no threads showing for best appearance. When the correct adjustment is established, tighten lock nut against crossbar to hold adjustment.
4. Remove the crossbar (A) assembly from electrical box.
5. Attach one end of the chain (H) to the fixture loop (I) using a chain spreader (not provided). Lace the wires through every other link of the chain to the end. Slip wires and chain through canopy ring (F) and canopy (E). Allow canopy ring and canopy to slide down chain and rest on fixture loop. Fasten the chain to the canopy loop (G).
6. Slip wires through the canopy loop (G) and nipple (C). Make sure to provide enough slack in the wire to ensure weight of fixture is supported by the chain.
7. Using two machine screws (not provided), reattach the crossbar (A) to the electric box.
8. Using suitable wire connectors (not provided) connect fixture wires to supply wires (white to ribbed side of the fixture cord, black to smooth side). Raise canopy (E) close to ceiling. Run a pigtail lead from crossbar ground screw (D) to the junction box and connect all ground wires (bare copper or green to bare copper or green

CAUTION: MAKE SURE WIRE CONNECTORS ARE TWISTED ON SECURELY AND NO BARE WIRE IS EXPOSED.

9. Raise canopy (E) to the ceiling and secure loop collar (F) to canopy loop (G).


CAUTION: BE SURE NO WIRES ARE PINCHED BETWEEN CANOPY (E) AND THE CEILING.

10. Install bulbs (not provided) into sockets (K).

ASSEMBLY & INSTALLATION INSTRUCTIONS

A567

Stella Chandelier 105057

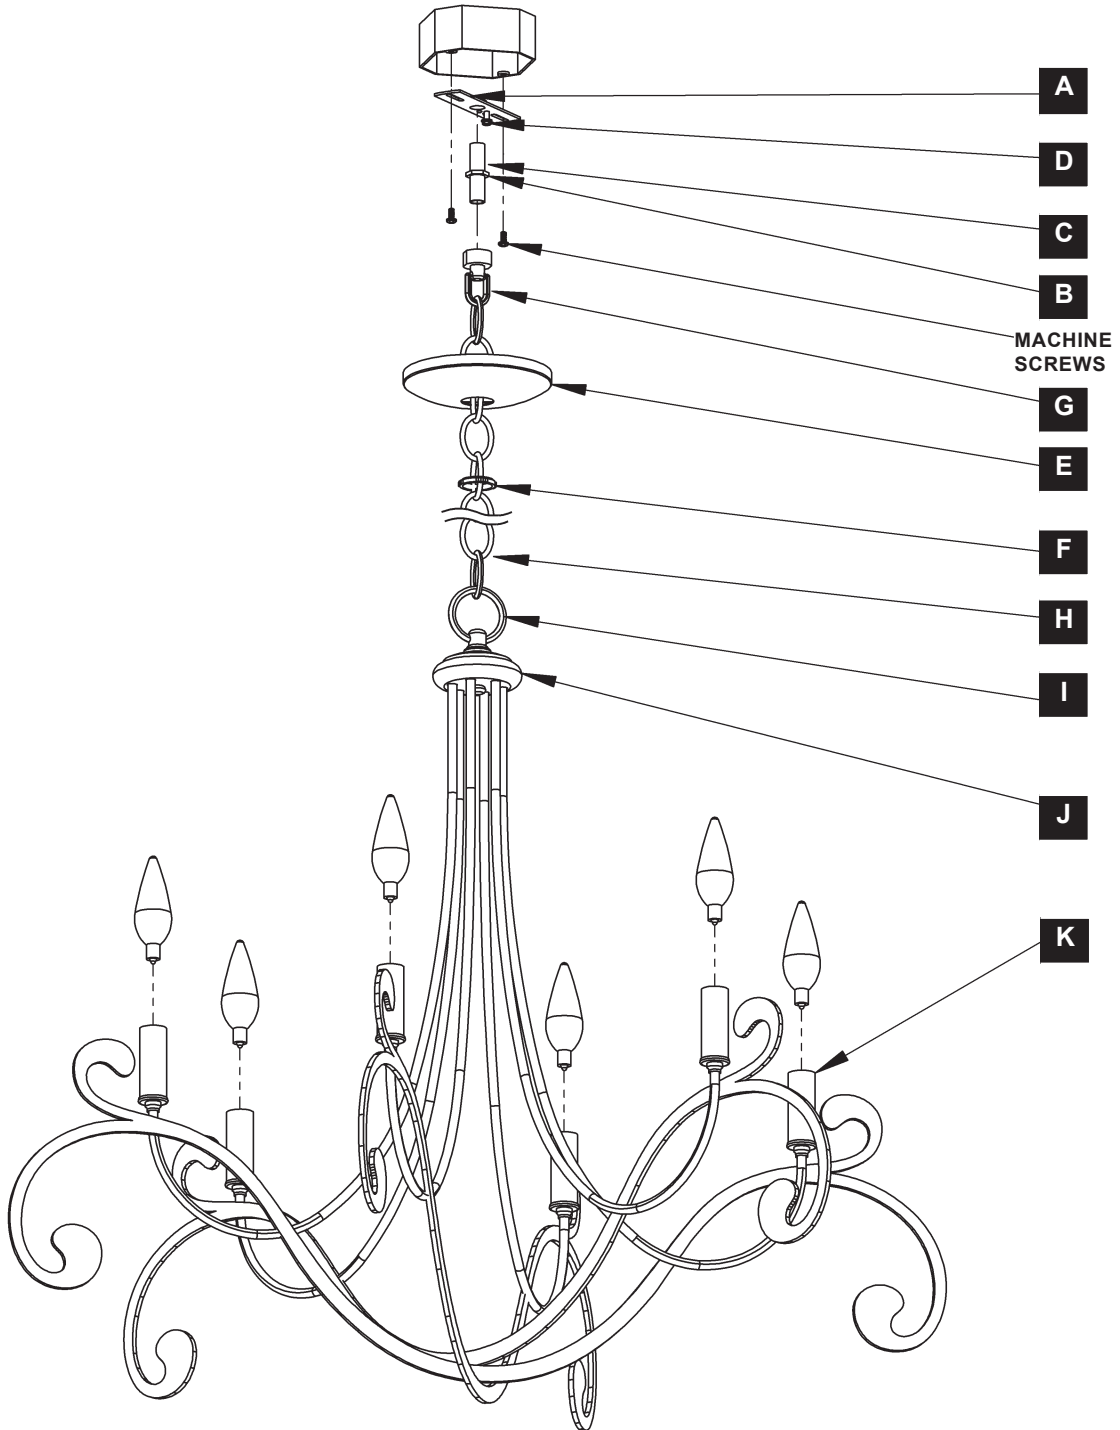

(Figure 1)



HUBBARDTON FORGE.

MODERN AMERICAN BLACKSMITHS | FINE, HAND CRAFTED LIGHTING
CASTLETON, VERMONT USA | HUBBARDTONFORGE.COM

42722 Rev A


ASSEMBLY & INSTALLATION INSTRUCTIONS

A567


Stella Chandelier 105057

To Install Crystals (Figures 2 & 3)

1. Locate the crystals (L) and white gloves.
Note: Using white gloves while handling the crystals will prevent smudges.
2. The crystals (L) are supplied with the pinch bail (M) already installed.
3. Locate the jump ring (N). Flex the jump ring so the post comes out of the hole. Feed the jump ring through the hole in the plate and the pinch bail (M).
4. Press ends of jump ring (N) back together so that post goes back through the hole.
5. Repeat steps with remaining crystals (L).
6. If needed, use the provided white gloves to polish the crystals.
7. Restore electricity at the main breaker.

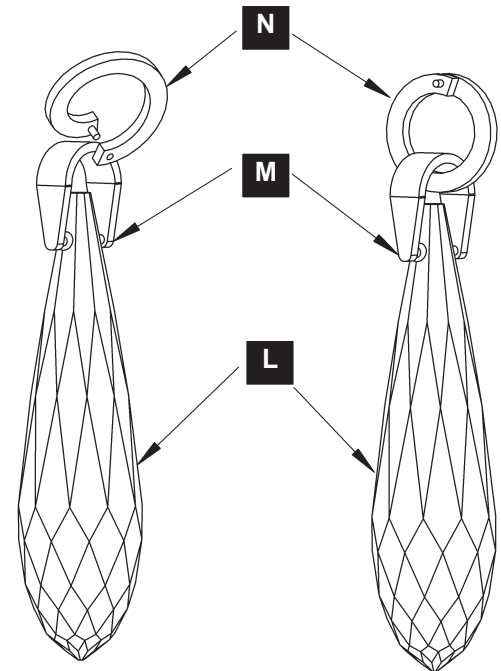

(Figure 2)

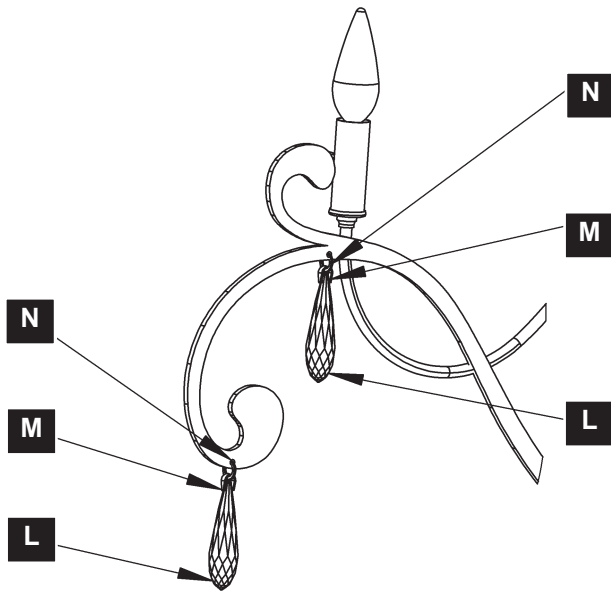

(Figure 3)

If you need further assistance, or find that you are missing any parts, please contact the dealer from which you purchased this product. We hope you enjoy your fixture!

*** Hubbardton Forge will not be liable for injury or damage caused by improper installation, lamping or use of this fixture.**